
Rockford Sanitary Systems, Inc. ROCKFORD, IL 61125-0963

(815) 229-5077 - (800) 747-5077 - FAX (815) 229-5108 WEB SITE-www.rkfdseparators.com E MAIL-rssem@rkfdseparators.com


MODEL NO. OSTL-5633-100


DIL/WATER SEPARATOR

DRAWN BY JOB NAME QUOTE # W.R.W.

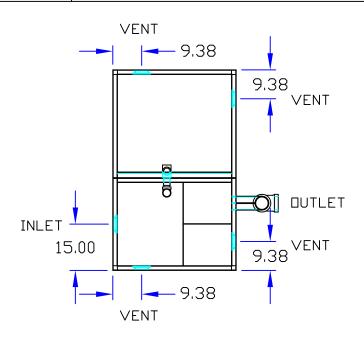

OPTIONAL FEATURES (ADDITIONAL COST) ☐ ANCHOR FLANGE ☐ FILTER MEDIUM ☐ RECESSED LIFT HANDLES IN COVERS ☐ EPOXY COATING ☐ ANODES REINFORCED COVERS ISTAINLESS STEEL CONSTRUCTION SEDIMENT BASKET ☐ INTEGRAL EXTENSION __ □INLET & OUTLET SIZE _____INCHES ☐ DOUBLE WALL CONSTRUCTION □LEAK DETECTION ☐ HIGH LEVEL SENSOR & ALARM ☐ COALESCING PACK PUMP DUT CONNECTION ☐ HOLD DOWN PADS ☐ DRY INLET ⊐ALUMINUM C□VER □ N□ HUB C□NNECTION ☐ HUB C☐NNECTI☐N

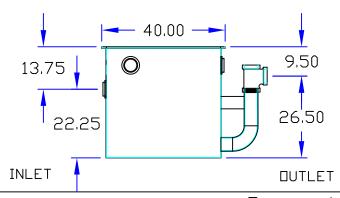

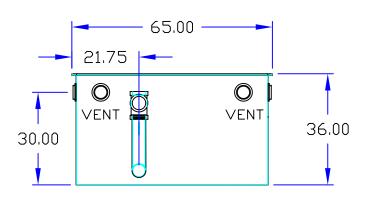

Specifications

Rockford Model OSTL-5633-100 Dil/Water Separator all welded A36 10 Ga steel, 65 g.p.m. intermittent flow, 100 gallon static capacity with 100 gallon waste oil storage, 4.00" threaded inlet/outlet & 4.00" threaded vent connections (4), visible double-wall outside trap seal, removable filter screen, non-removable separator screens, 3/16" nonskid treadplate covers (4) (for flush-with-floor installation) for pedestrian traffic secured with stainless steel bolts with heavy duty leakproof gasket, OPEX SHOP COAT coating inside & bituminous coating outside.

Optional features (Additional cost) listed above

Approved By

Company

Date